




## 3540M Torque Curves


### HT11-012 MOTOR

Motor Connection: 4 Lead Bipolar  
Drive Setting: 1/10th Step • 1.0 A/Phase

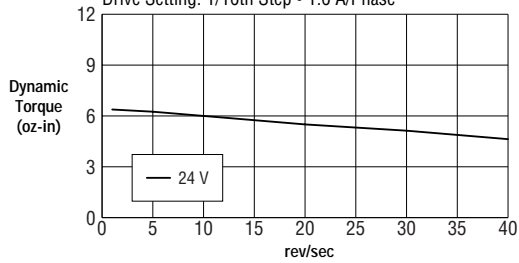


### HT11-013 MOTOR

Motor Connection: 4 Lead Bipolar  
Drive Setting: 1/10th Step • 1.0 A/Phase

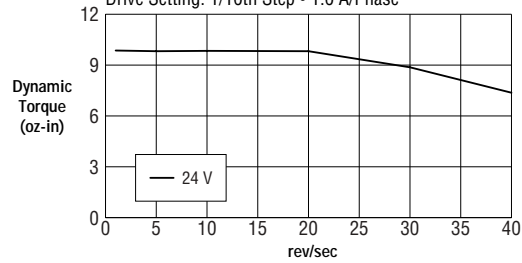


### 5014-842 MOTOR

Motor Connection: Parallel  
Drive Setting: 1/10th Step • 1.0 A/Phase

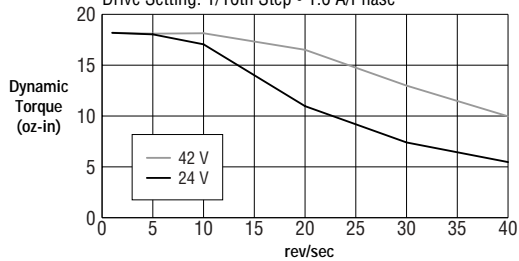


### HT17-068 MOTOR

Motor Connection: Parallel  
Drive Setting: 1/10th Step • 1.3 A/Phase

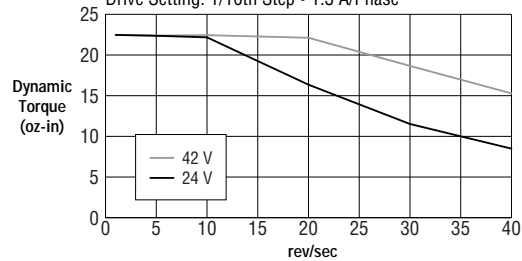


### HT17-071 MOTOR

Motor Connection: Parallel  
Drive Setting: 1/10th Resolution • 1.7 A/Phase

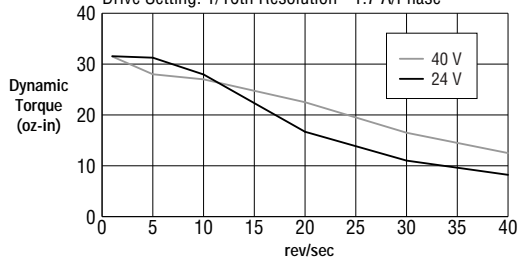


### HT17-075 MOTOR

Motor Connection: Parallel  
Drive Setting: 1/10th Step • 1.75 A/Phase

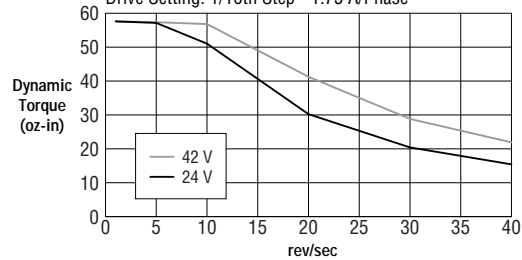


### HT23-394 MOTOR

Motor Connection: Parallel  
Drive Setting: 1/10th Step • 2.8 A/Phase

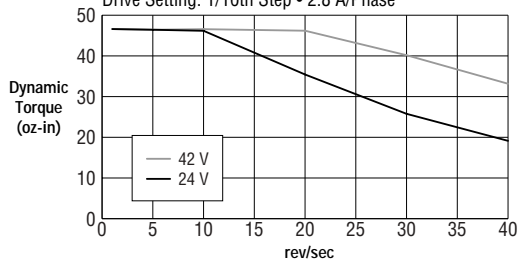


### HT23-397 MOTOR

Motor Connection: Parallel  
Drive Setting: 1/10th Step • 2.8 A/Phase

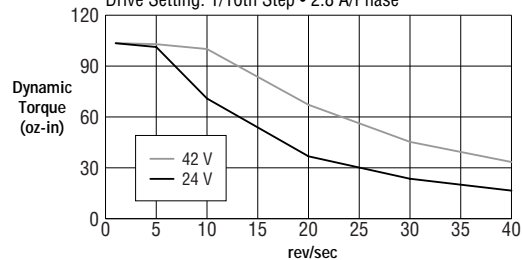

### HT23-400 MOTOR

Motor Connection: Parallel  
Drive Setting: 1/10th Step • 2.8 A/Phase

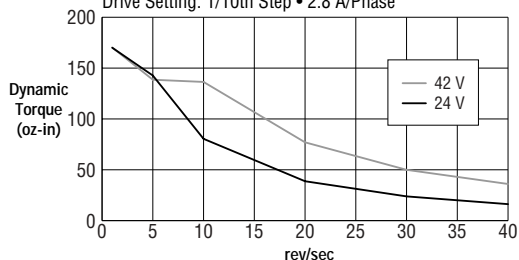

### 5034-348 MOTOR

Motor Connection: Parallel  
Drive Setting: 1/10th Step • 3.5 A/Phase

